




Possible Leakage of EP-0 Injectors

Batch Numbers C1143 & C1147

We've had reports of some of the injectors identified above leaking at the joint where the knurled top and hex barrel are connected. The cause is "not enough loctite applied to threads during manufacturing procedure". This issue was discovered by technicians installing and after doing so running the system in accelerated cycle mode for a while. Secondary line pressure then builds and leaking starts. We've done some investigating and found the problem to be limited to the above batch numbers. These are part of the most recent shipment, which we've only been sending out for a short while. Please inspect your inventory to see if you have any injectors with these numbers on them.

Example of leak:

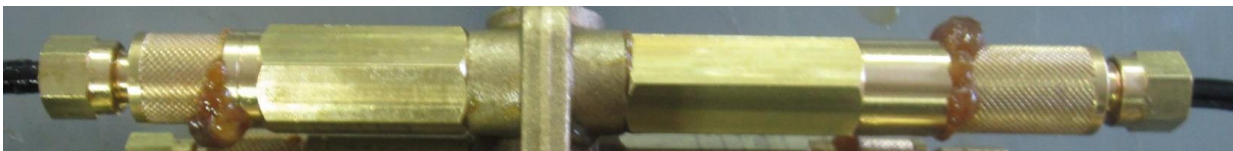

The following are possible solutions:

Send all injectors back to be replaced, or see included document:
"Recommended Leak Prevention Procedure"